

## Error 714 Battery communication issue


Error **714** indicates that there is no communication between the inverter and the battery. The battery will turn off after about 10 minutes if it cannot communicate with the inverter, which will cause error 703.

Check:

1. that the battery type setting is correct;

Battery Type	1/3	Battery Type	2/3	Battery Type	3/3
<input checked="" type="radio"/>	No Battery	<input checked="" type="radio"/>	Li-ion Pylon	<input checked="" type="radio"/>	Li-ion BYD
<input type="radio"/>	Li-ion Sungrow	<input type="radio"/>	Li-ion GCL	<input type="radio"/>	Lead-acid Narada
<input type="radio"/>	Li-ion LG	<input type="radio"/>	Li-ion BlueSun	<input type="radio"/>	Other Lead-acid

2. the battery communication cable connection.

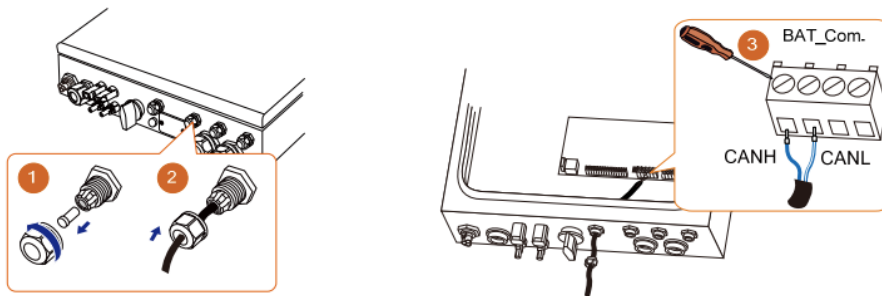

Check that the supplied cable is used and that the connections for the inverter are correct. Test the continuity of the battery communication cable. If it is faulty and the please try another battery communication cable.

If the fault persists, please contact Sungrow Service Department and send photos.